Best Practice Excursion "Gangbach" (Schächental, Uri)

Karl Grunder¹⁾, Roland Stalder¹⁾, Christian Rickli²⁾, Frank Graf³⁾

1) oeko-b ag, Weidlistrasse 2, CH-6370 Stans

²⁾ Swiss Federal Institute for Forest, Snow and Landscape Research WSL, Zürcherstr. 111, CH-8903 Birmensdorf
³⁾ WSL Institute for Snow and Avalanche Research SLF, Flüelastrasse 11, CH-7270 Davos Platz

Schedule

Thursday, 12 th June 2014	in the evening dinner ca. 20:00	Arrival, dinner and overnight stay in Hotel Höfli, Altdorf (optional) → more information see separate document "how_to_reach.pdf"
Friday,	dep. 08.15	Departure from Hotel Höfli to the Gangbach catchment with minivans
13 th June 2014	dep. 08.45	1st part of the excursion according to the excursion programme
	ca. 11.45	Lunch in restaurant Biel, Bürglen
	dep. 13.00	2 nd part of the excursion and subsequent return to Altdorf/Flüelen
	dep. 16.10	Departure of train from Flüelen and/or optional "after-work drink"

Local Management: Beat Annen, Head of Office for Forest and Hunting, canton Uri

Overall Organisation: Karl Grunder and Roland Stalder, oeko-b ag

Professional Support: Frank Graf and Christian Rickli, WSL/SLF; Martin Frei, MFrei Infra GmbH

Main goal

Presentation and discussion of practical measures for protection against superficial landslides in order to give input for applied research in respect of quantifying "Vegetation Effects on Soil Stability".

Leading question

We want to timely maintain and improve soil stability with respect to preventing natural hazards! How can we profit from and appropriately apply vegetation?

Why the "Gangbach" area?

The "Gangbach" is the most important headwater of the dangerous mountain river "Schächen" (canton Uri) and subject of different studies and protection measures since more than a century. This is shown by many examples among which are of recent times:

- 1980: first standardised key-kit for geomorphological phenomena in torrent catchments (A. Sandri);
- 1982: one of the first courses held by the "Swiss Federal Forest Task Force for Torrent Control and Slope Stabilisation";
- 1987: international workshop on the "Consequences of Forest Damages to Mountain Rivers in Switzerland" organised by WSL.

Spatial context: Flood hazard caused by the "Schächen"

Bed-load played a key role in context with the disastrous floodings in 1910, 1977, and 2005. The main cause of the vast out-bursts was the overload of the lower course with bed-load and associated backwater at the river mouth of the "Schächen" into the "Reuss" and the resulting aggradation of the lined ditch of the "Schächen". After the floodings of 1910 and 1977 many headwaters of the "Schächen" were corrected and debris retention basins constructed. Furthermore, large areas were afforested and stabilised with joint technical and biological measures, particularly in respect of torrent control and slope drainage (1st part of the excursion). First measures were taken in 1932, when the Canton bought 70 hectares of land from the farmers in order to pursue the restoration project.

After the flooding of the valley bottom of "Uri" in 1987, the protection system has been renewed, reinforced and complemented. Nevertheless, the "Gangbach" remains the most important bed-load source and supplier of the "Schächen". Protection measures were calibrated based on a 100 years return period. The estimated replacement value of the protection measures in the "Schächen" catchment constructed from 1910 to 2005 adds up to 90-100 millions of Swiss Francs.

During the event of 2005, the most important amount of bed-load transport into the "Schächen" originated from the landslide "Lotter" of the "Gangbach" catchment (2nd part of the excursion). As a consequence of the 2005 floodings the cost estimate for protection measures planned for the period 2010-2016 of the lower course and river mouth of the "Schächen" into the "Reuss" was about 65 millions of Swiss Francs. However, only minor projects have been scheduled for the "Gangbach" catchment.

Characteristics of the "Gangbach" catchment

The upper part of the "Gangbach" catchment is characterised by steep rock faces of "Quintener" limestone and permeable screes. In the main part of the catchment that is formed by soft rock, in particular

by "Wildflysch" shale, a densely branched network of watercourses has been developing. In the lower part of the catchment native limestone and roof slate are dominating (Fig. 1). Hydrology plays a key role in the catchment processes: in the upper part of the catchment water tends to infiltrate completely. Towards the bottom part of the catchment water is springing up causing shallow landslides which often evolve into mud flow or provoke deep seated landslides.


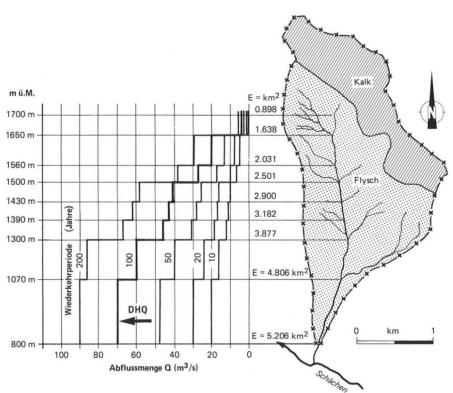



Fig. 1: Geology, network of watercourses, and design floods of the "Gangbach" (WSL 1987).

The area centroid of the "Gangbach" catchment is on an average altitude of 1700 m asl (Fig. 2).

The relative altitude distribution of the "Gangbach" catchment is distinctly convex and the age of development only approaching the medium stage. Therefore, the tendency for further deepening of the channel is still considerable (Fig.3).

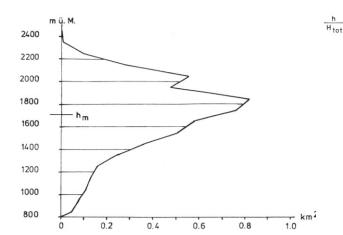

<u>Fig. 2</u>: Absolute distribution of altitude in the "Gangbach" catchment (Forest Service Uri/Forest and Hunting, 1982).

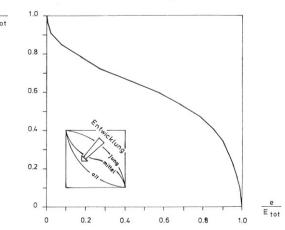

<u>Fig. 3</u>: Relative distribution of altitude in the "Gangbach" catchment (Forest Service Uri/Forest and Hunting, 1982).

Visited objects during the excursion

First Part

Upper montane to subalpine afforestation areas of different age, combined with drainage measures and technical stabilisation constructions. Variable soil depths of the erosion processes. Different development stages with different management and maintenance strategies.

• Afforestation area 1 ("Äbnenegg"):

Afforestation and drainage measures from the 1920s established on areas of superficial to deep seated landslides. In the last couple of years the first regeneration cuts were applied within the management of protection forests; following the guidelines of NaiS (Sustainability in the Protection Forest).

• Afforestation area 2:

More recent afforestation and drainage measures established on areas of superficial landslides. The drainage system was built to collect the water in this upper part of the catchment in order avoid massive infiltration which emerges down slope. After setting up the drainage system, afforestation was performed with the purpose of primarily controlling the fluxes of water considering both interception and infiltration. Plants were grouped in collectives with the intention of obtaining a "mosaic structure" (Rottenstruktur) typical for subalpine forests, allowing heterogeneity above- as well as belowground (root systems).

Afforestation area 3:

Afforestation and drainage from the 1940s established on areas of medium- to deep-seated landslides.

• Afforestation area 4 ("Giegen"):

Afforestation from the 1990s, combined with technical measures against avalanche starting on medium-seated landslides.

Second Part

Initial vegetation stages and agricultural areas on steep slopes of the upper montane region. Variable soil depths of the erosion processes. Different requirements on the vegetation with corresponding strategies of management and maintenance.

Landslide "Lotter":

For a long time active area of medium- to deep-seated landslides.

Largest landslide in the valley of the "Schächen" during the heavy rainstorms in 2005 with tremendous consequences on the bed-load discharge of the "Schächen".

Combined with stabilising log crib-walls and drainage measures, the re-colonisation with protecting vegetation of areas affected by landslides plays a central role in torrent control and, particularly, in order to prevent bed-load transport. Currently, the maintenance measures are restricted to technical constructions (i.e. cleaning of the drainage channels) and do not consider care and maintenance of vegetation.

Agricultural area:

In recent years, the continuation of the agricultural use of the steep slopes has become more and more doubtful. However, in this particular case it has been agreed to continue, not least on behalf of decentralised settlements and biodiversity. In other regions, landslide affected areas have been afforested or left for natural re-afforestation. A site-adapted land-use is decisive for biodiversity as well as for an appropriate protection against erosion. The agricultural use may differ due to operational reasons.

Some practical questions/demands related to excursion and REVENUES

From Practitioners to Administration and Science:

- 1. Recommendation for application, justification, management, and maintenance of vegetation used for slope stabilisation with regard to long-term protection functions (superficial, medium-and deep-seated landslides).
 - A main question is how and how long plants should be managed in the long-term, considering also economic issues.
- 2. Advantages and disadvantages of "artificially pushing" vegetation development on slopes affected by landslides/erosion compared to natural re-colonisation and succession processes? Vegetation self-regenerates; but do local environmental conditions meet the requirements to ensure this process?
- 3. How do plant succession processes affect soil weathering and soil aggregate composition (→ change in particle size distribution?) and what are the corresponding consequences for long-term slope stability?
- 4. What are negative effects of certain vegetation types in respect of (re-) stabilisation of slopes susceptible to superficial soil failure?

In general, there is demand of more scientifically based information as well as data on the potential of vegetation to stabilise slopes and, in particular, the need of long term monitoring of bioengineered slopes, concerning both vegetation and hydrological aspects

From Scientists to Practitioners:

- 5. What information and in which form is needed in respect of plant effects on slope stability related to protection against superficial soil failure in order to appropriately include vegetation into rehabilitation concepts and slope stability calculations?
- 6. What would change in hazard assessment and taking measures against superficial soil failure, if plant effects on slope stability are reliably quantifiable?

"Undirected":

7. Which are decisive vegetation parameters in order to appropriately consider plant effects on slope stability in safety analysis and to quantify them, respectively?

Further questions not directly related to REVENUES:

- Should original vegetation patches at the border and/or within a failed slope area be left although they were slipped or are partly cracked?
 What are advantages and what are the risks?
 What are the consequences in respect of the restoration strategy?
- How and within which time-scale does a stop of grazing/cultivation affect slope stability?
- How and within which time-scale does abandonment/a stop of fertilising affect slope stability?
- What consequences has a cutting back of vegetation applied for slope stabilisation with regard to root development?

Is a cutting back after a longer period (~10 years) useful to further improve root growth?

Participants of the excursion

1 Annen	Beat	Cantonal Administration	organiser
2 Askarinejad	Amin	TU Delft / ETH Zürich	
3 Bebi	Peter	SLF / WSL	
4 Braschler	Urs	Cantonal Office	
5 De Cesare	Giovanni	EPFL, Lausanne	
6 Frei	Martin	MFrei Infra GmbH	
7 Graf	Frank	SLF / WSL	organiser
8 Greminger	Peter	Senior Consultant	
9 Grunder	Karl	oeko-b ag	organiser
10 Hählen	Nils	Cantonal Office	
11 Jommi	Cristina	TU Delft	
11 Jommi 12 Rickli	Cristina Christian	TU Delft WSL	organiser
			organiser
12 Rickli	Christian	WSL	organiser
12 Rickli 13 Sandri	<i>Christian</i> Arthur	WSL Federal Administration	organiser organiser
12 Rickli13 Sandri14 Springman	Christian Arthur Sarah	WSL Federal Administration ETH Zürich	
12 Rickli13 Sandri14 Springman15 Stalder	Christian Arthur Sarah Roland	WSL Federal Administration ETH Zürich oeko-b ag	
12 Rickli13 Sandri14 Springman15 Stalder16 Steiger	Christian Arthur Sarah Roland Urs	WSL Federal Administration ETH Zürich oeko-b ag Swiss National Foundation	
12 Rickli13 Sandri14 Springman15 Stalder16 Steiger17 Thali	Christian Arthur Sarah Roland Urs Urs Chiara	WSL Federal Administration ETH Zürich oeko-b ag Swiss National Foundation Thali, Consulting Engineer	

Members of the EU project **REVENUES**

Impressions of the "Best Practice Excursion" in the Gangbach area, 13th June, 2014



Karl Grunder welcomes participants



Beat Annen introduces the area



Last instructions before the start ...



Animated discussions ...



Beat Annen explains management strategies in order to stabilise steep slopes under cultivation



The "Lotter" landslide, main debris source of the 2005 event



Beat Annen explains the principles of combined stabilisation measures related to the "Lotter" landslide



Arthur Sandri particularises the view of the Federal Administration in respect of vegetation effects on slope stability



Object-related knowledge transfer



Meadow or forest for long-term stabilisation of steep slopes ...?